


召回一批双缸点火系统

数量约 1000 只,发货时间范围,2010 年 9 月~2011 年 4 月
因该批点火系统程序错误,会引起手启动困难,必须用力拨,
但如果使用启动器没有问题,,或移动霍尔传感器到 34 度提前角也可以使用.
如手启动有困难的双缸点火器,请检查是否有如下特征.
该批号特征如下,揭开外壳底部商标,打开底壳,转速信号线套有白色套管的标记,就有可能在此批次.详细见图.,其他批次没有任何问题.

Recall a batch twin ignition system

Quantity to about 1000 pcs , shipping time about , September 2010 ~ April 2011
Because program errors the ignition system of the batch Hand-start the engine will cause difficulties, They cant be hand started by flipping the prop as usual.Each one, if there is no problem using the starter or setting the timing at 34 degrees BTDC and they started perfectly.
If the hand is difficult to start the engine, please check to see if there are features
The batch features are as follows
Opened the ignition box bottom of the label, Open the bottom shell, speed RPM signal lines marked with white casing, It is possible in this batch
Details see Fig., The other batch without any problems

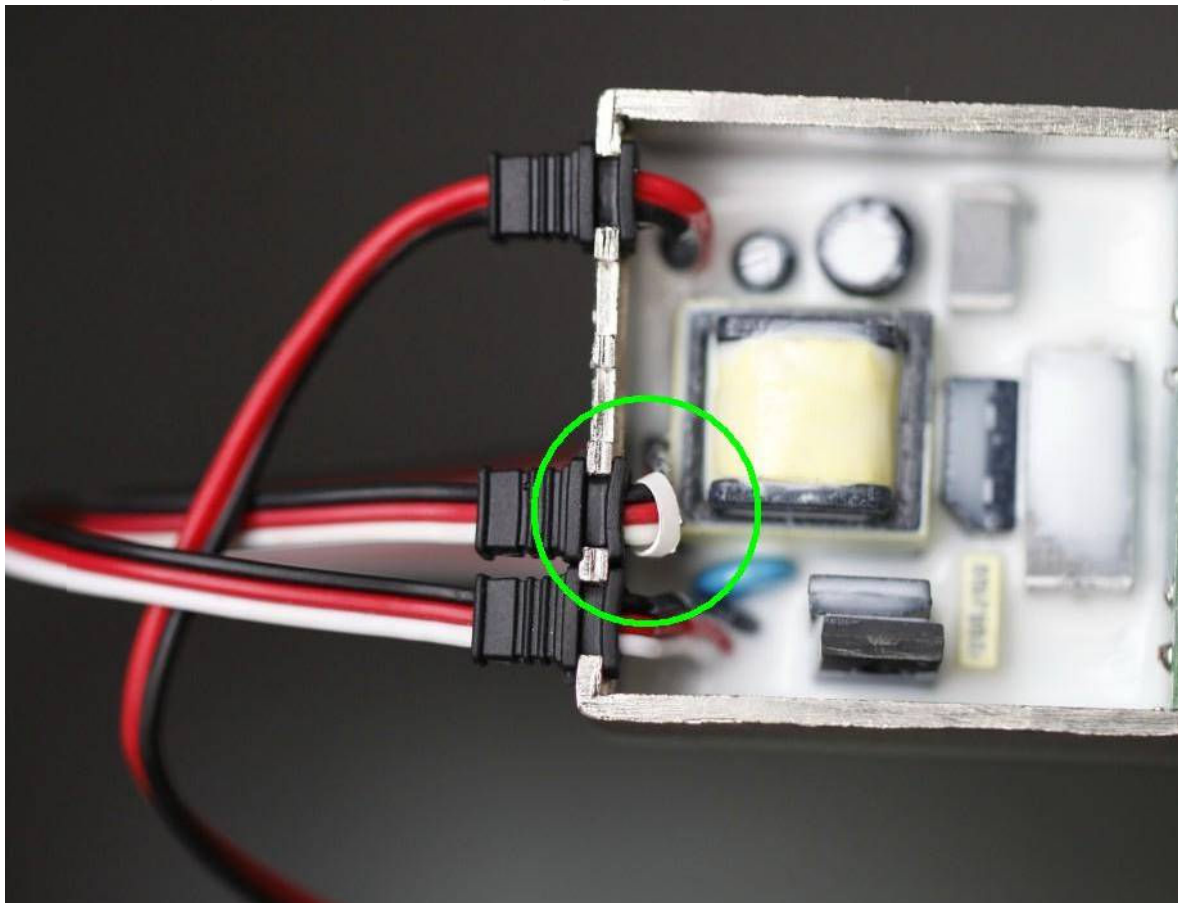

Jinhua RC Electronic CO., LTD
Address: 3F Building 3 NO.966, Jin Fan Street, Jinhua City Zhejiang
Province China P.C:321016
name: Xu Liang tel: +86 579 82878074

